

By use in explosive hazardous areas read and follow the

special conditions and instructions for safe application

of the attached

explosive protection information

B1 / B2



first and take notice of the operating instructions.

Operating instructions

1. Description

1.1 Intended use

The pressure detector controls as limit switch the over pressure in silos and vessels.

1.2 Function

If the pressure reaches the switching point **SP**, the pressure detector will give a signal.

1.3 Technical data

Manufacturer

MOLLET
Füllstandtechnik GmbH

Address

Industriepark RIO 103
74706 Osterburken

Silo pressure detector

Type

MSD-A. F1 . B.

Bulk good temperature
Ta -25 °C ... +80 °C

Ambient temperature
Ta -20 °C ... +70 °C

Signal contact
max. switching voltage
max. switching capacity

Contact
see type plate

Switching point SP 40 mbar = 0.04 bar = 400 mm WS

Over pressure safety up to 0.5 bar

Cable connection Screw M4

Cable entry Cable gland M20v1 5

Cable entry Cable gland M20x1.5

Type of protection | P | IP66 | acc. to DIN EN 60529

Weight 1.2 kg Maintenance none

Mounting position vertical, \pm 5° inclination


1.4 Material

Housing Aluminium or stainless steel 316
Flange Aluminium or stainless steel 316 Ti


Membrane Stainless steel 304

Flange socket Steel

1.5 Dimensions

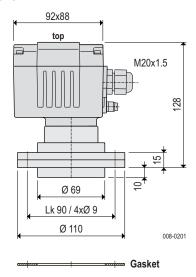

1.6 Accessory (Option) Flange socket

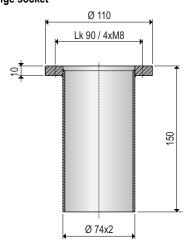



Silo pressure detector **MSD-A**



2. Installation

2.1 Preparation


- Check the membrane of visual transport damage.
- Read and follow the safety instructions and the operating instructions, before handling with the device!

2.2 Mounting in the vessel

- Weld the flange socket (as a option) vertical (Flange is horizontal) in the silo top.
- Position the pressure detector (Flange is horizontal) with the gasket at the provided flange or flange socket and fix it with 4 washers and screws M8.

2.3 Electrical connection

Circuit diagram







2.4 Cable gland

- After electrical connection, tighten the cable gland.
- Screw the cap nut, until the cable entry is closed tightly.

2.5 Cable run

Run the connection cable in a way that no traction can occur at the pressure detector.





2.6 Switching point

- The switching point is adjusted at 40 mbar.
- A modification may be carried out by the manufacturer only.

3. Utilization

3.1 Commissioning

 Put the pressure detector into operation only, if the installation in the silo or vessel and the electrical connection have been done correctly.

3.2 Normal operation

- Use the pressure detector in its intended application only.
- Comply with the specifications on the data plate.
- Damaged devices have to put out of operation immediately.
- The pressure detector must not be modified. If there is any modification, the warranty of the manufacturer will be, cancelled.

3.3 Inexpert handling

- Ignoring of the safety instructions and the operating instructions.
- Not intended use.
- Modification at the device or of the switching point adjusting.
- Violation against applicable law and standards.

4. Maintenance and servicing

4.1 Maintenance

- In case of intended use, the silo pressure detector needs no maintenance.

4.2 Servicing

 The servicing of the pressure detector may be carried out by the manufacturer only.

5. Storage

- Store the pressure detector dry and dust-free.
- Protect the membrane from damage.

6. Disposal

- The pressure detector can be recycled.
- The disposal applies to the valid environmental guidelines according to the location of the carrier and the local manufacturing conditions.





Silo pressure detector with aluminium housing


MSD-A



Explosion protection information

and supplement to the operating instructions

Type plate details

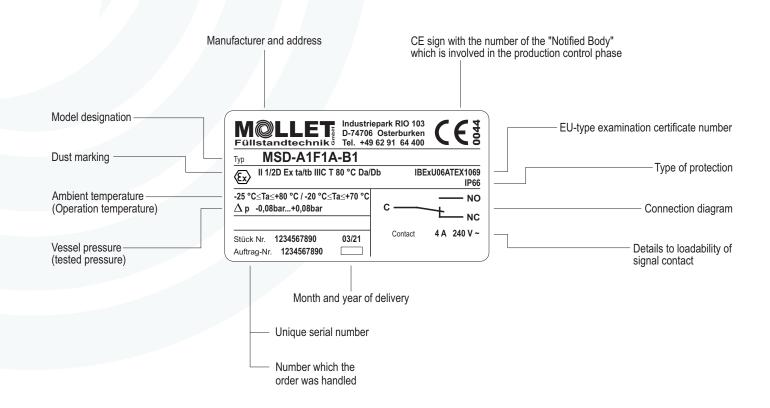




Competence in explosion protection



Silo pressure detector **MSD**



Marking in accordance with ATEX and DIN EN IEC 60079-0

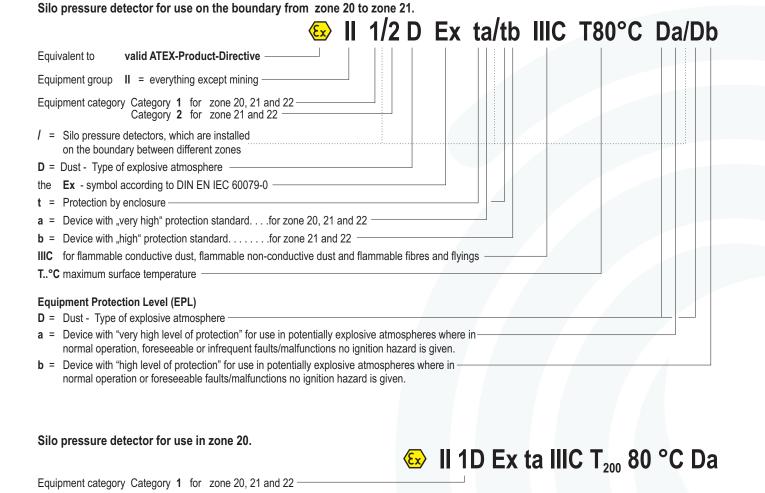

Silo pressure detector



Order code B1

Marking: II 1D / 2D



Equipment category appropriation by zones


Silo pressure detector for use on the boundary from zone 20 to zone 21.


Ambient temperatures Ta

The ambient temperature Ta defines the maximum operating temperature of the detectors. Inside the vessel this is process temperature (the air or the bulk goods temperature) nearby the device.

maximum surface temperature T

The maximum surface temperature means the hottest point at the equipment.

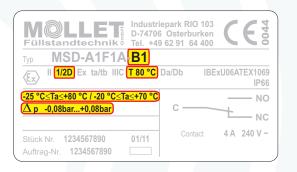

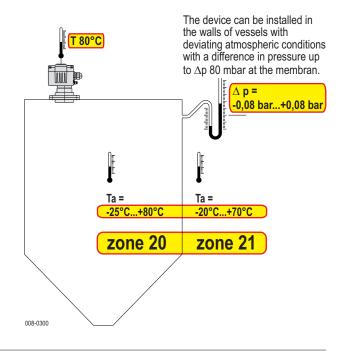

Order code B2

Marking: II 1D



Equipment category appropriation by zones


Silo pressure detector for use in zone 20.


Ambient temperatures Ta

The ambient temperature Ta defines the maximum operating temperature of the detectors. Inside the vessel this is process temperature (the air or the bulk goods temperature) nearby the device.

maximum surface temperature T

The maximum surface temperature means the hottest point at the equipment.

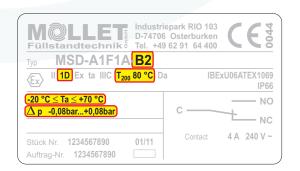

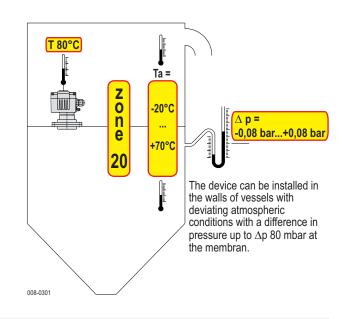



Silo pressure detector **MSD**





Special conditions and instructions for safe application

- The installation, maintenance, initial operation, removal and repair have to be controlled resp. checked by an "authorized person" for explosion protection.
- 2. For the electrical connection you have to take notice of the local and statutory requirements and/or the VDE 0100.
- 3. Take notice of the specifications on the data plate.
- 4. A fuse (with max. 4A) has to be connected in series to the voltage supply.
- 5. Protect the signal contact from voltage peaks when inductive loads are connected.
- 6. As soon as the device will be brought into the explosion hazardous area it has to be mounted immediately at the precaused place and a cable has to be brought into the cable gland.
- 7. Using the device in ambient temperatures > +60 °C, the applied connection cables have to be made for temperatures of min. +80 °C.
- 8. The cable gland and the plug screw were screwed and protected at the factory. Please check if they have loosened during on the mounting or at the transport. When it is loosened, it has to be fitted again.
- To secure the type of protection, the screw nut of the cable gland has to be fixed at the installation with a torsional force of min. 5.0 Nm. ATTENTION! If it will be fastened too strong, the IP-protection can be affected.
- 10. The earth connection of the device has to be installed in such a way that mechanical damage will be excluded.
- 11. The device may put into operation with intact cap-sealing and when it is closed, only.
- 12. Switch off the power supply, before opening the device. (touchdangerous voltage)
- 13. Using the Silo pressure detector in the silo wall under deviating atmospheric conditions the maximum differential pressure has not to exceed 80 mbar and the working temperature has not to exceed +80 °C at the membran.
- 14. In case of existing combustible dusts with a minimum ignition energy less than 3 mJ or with a minimum ignition temperature under +300 °C (BAM assessment), the parts in contact with the dust must be made of stainless steel.
- 15. Take notice of the requirements of DIN EN 60079-14, DIN 60079-17 and DIN EN 1127-1, especially regarding the dust deposits and temperatures and follow the pertinent rules and regulations.
- 16. ATTENTION safety device!

Don't modify anything at the device or at the switching point adjusting!



EUKE	UKE-MSD	
Index	0	
Seite/Pag	ne 1 von/of 1	

EU-Konformitätserklärung EU-Declaration of Conformity

Wir/We MOLLET Füllstandtechnik GmbH

Industriepark RIO 103 D-74706 Osterburken Tel. 06291 64400 Fax 06291 9846

erklären in alleiniger Verantwortung, dass das Produkt: declares under our sole responsibility, that the product:

Silo-Druckmelder/Silo pressure detector

Typ/Type MSD-070..., MSD-A...

den folgenden Europäischen Richtlinien entspricht: conforms with the following European directives:

Niederspannungsrichtlinie Low voltage directive 2014/35/EU

Angewandte harmonisierte Normen oder normative Dokumente: Applied harmonized standards or normative documents:

DIN EN 61010-1:2020 DIN EN 60529:2014

Und die Geräte mit 🖾 - Kennzeichnung entsprechen zusätzlich der folgenden Europäischen Richtlinie: And the devices with 🖾 - marking conform additional with the following European directive:

ATEX-Richtlinie ATEX directive 2014/34/EU

Je nach Ausführungsvariante angewandte harmonisierte Normen oder normative Dokumente: Depending on the design applied harmonized standards or normative documents:

DIN EN IEC 60079-0:2019 DIN EN 60079-31:2014 **DIN EN 60079-11:2012**

DIN EN 60079-26:2015

EU-Baumusterprüfbescheinigungsnummer:

EU-Type Examination Certificate:

IBExU06ATEX1069

Ausgestellt von:.

Issued by:

IBExU Institut für Sicherheitstechnik GmbH, 09599 Freiberg (0637)

Qualitätssicherung:

Quality assurance:

TÜV NORD CERT GmbH, 30159 Hannover (0044)

MOLLET CHOWN THE PARTY OF THE P

Osterburken, den 03.06.2022

Wolfgang Hageleit
Geschäftsführer / Managing director

Diese Erklärung darf nur unverändert weiterverbreitet werden. This declaration is only allowed to hand out in unchanged form.